

PG-U Pressure Transducers INSTRUCTION MANUAL

Thank you for purchasing the KYOWA product. Before using it, read this instruction manual carefully. Also, keep the manual within easy reach so that you can refer to whenever necessary.

Specifications and dimensions described in this manual could be changed without notice. Please visit our website for the latest version.

1. Calling the operator's attention

The following cautionary symbols and headlines are used to invite the operator's attention. Be sure to observe the accompanying precautions in order to safeguard the operator and preserve the performance of the instrument.

 Warning	Improper handling can cause serious injury to the operator.
 Caution	Improper handling can cause deleterious effects to the operator's body.
Caution	Cautions are given to invite the operator's attention, in order to avoid instrument failure or mal-function.

2. Important notice

Unless specified, the transducer must not be used under hydrogen environment.

3. Safety precautions

 Warning	● Avoid pressure in excess of the allowable overload rating, or the instrument can explode. ● Avoid contact of a projecting object with the sensing surface, or the latter may crack to result in the transducer's explosion. ● Use the specified tightening torque. Improper tightening torque may cause the transducer's explosion. ● If excessive pressure could possibly occur, provide protective casing around the transducer installation, in order to safeguard the operator. ● Select sufficiently strong material for mounting screw hole.
--	--

 Caution	● Dismount the transducer only after the applied pressure has been completely removed. ● SUS630 (JIS G4303) is used where the transducer contacts a liquid. Avoid application of the transducer to a corrosive liquid or gas. ● Do not use PG-200KU to PG-500KU for endurance / fatigue tests. ● The PG-U have air vent screw with slot. Avoid using for a long-term measurement of gas pressure if much importance is attached to the stability of output in a minute range.
--	--

4. Handling precautions


Caution

- Do not disassemble the transducer.
- Take care to keep the liquid-contacting part and mount screw from damages.
- Protection code is IP54. It should not be used underwater.
- No condensing. If it formed condensation, immediately dry.
- Do not bend the cable at its outlet.
Make sure that the bending radius of cable is longer than 6 times of a diameter of the cable.
- In vibration environment, fix the cable at its outlet and required portions.
- Mount the transducer possibly closest to the pressure source.
- If the rising time of the dynamic phenomenon to be measured is short, the total response including the transducer and measuring instrument in use may be problem.
Before measurement, check their specifications.

5. Mounting

5.1 Using a gasket, mount the transducer. Apply your spanner to the spanner rest on the connecting screw section (Flat-to-flat 14mm) or the transducer may be damaged. Also, turn the cable together to protect the cable from damage due to twisting.

- Recommended tightening torque is 30 N-m.
- Allowable maximum tightening torque is 60N-m.

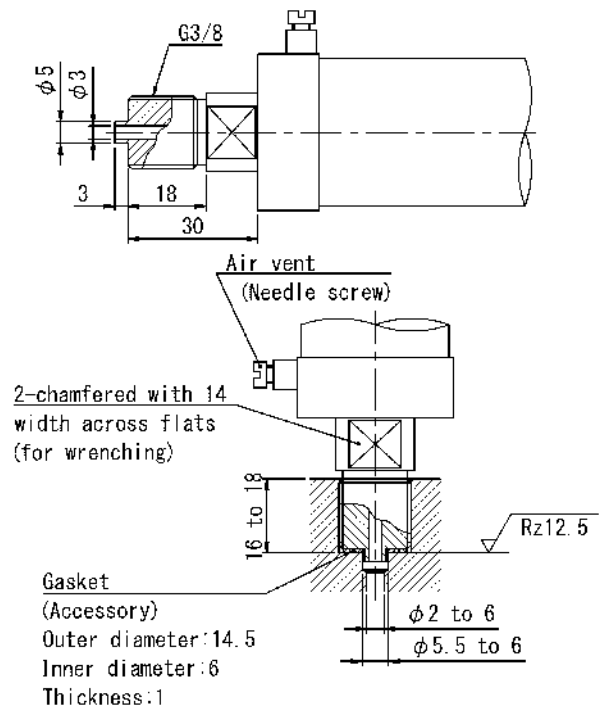

5.2 Use a new gasket.

5.3 A seal tape may be tied around the screw for sealing.


5.4 If the measurement object fluid is a liquid, allow the liquid to enter into the pressure chamber by loosening the needle screw provided on the transducer, thereby letting contained air go out.

- Tightening torque for the needle screw is 0.5 N-m.

5.5 When conduit is used, install a cock or valve between the conduit and connection portion to easily mount and demount the wire conduit.

6. Connection

- 6.1 Connect the transducer to a measuring instrument.
 6.2 When using a measuring instrument other than KYOWA, connector plug as follows.

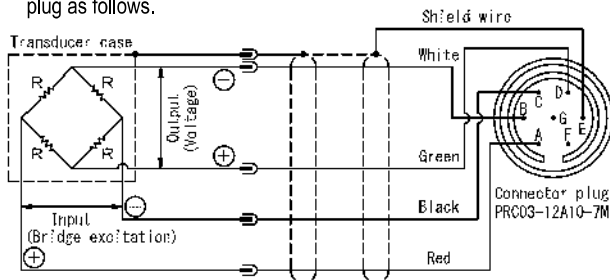

When connected the attached cable, shield wire is connected to the case.

- 6.3 Heat run for 5 minutes or longer before starting the measurement.

7. Conversion

- 7.1 Use the calibration constant described in the test data sheet to convert a reading into a pressure value.
 7.2 When a strain amplifier is in use, output reads in $\times 10^{-6}$ equivalent strain. Find a pressure value corresponding to $\times 10^{-6}$ strain. Then, obtain a pressure value through multiplication using the following equation.

$$\text{Pressure (Pa)} = \text{Strain amplifier's output } (\times 10^{-6} \text{ strain}) \times \text{Calibration constant (Pa} / \times 10^{-6} \text{ strain)}$$

- 7.3 When using an amplifier of other type or a recorder, first find the exact bridge exciting voltage applied. Second, find the pressure value that corresponds to 1(μ V) output voltage against 1(V) bridge excitation voltage. Then, obtain the pressure value through multiplication using the following equation.

$$\text{Pressure (Pa)} = \frac{\text{Bridge output voltage } (\mu\text{V})}{\text{Bridge excitation voltage (V)}} \times \text{Calibration constant (Pa} / 1\mu\text{V/V)}$$

Sensitivity Decrease due to Cable Extension

If a strain-gage transducer is connected to a signal conditioner, digital indicator or strain amplifier via extension cable, we will not ignore the sensitivity decrease due to the extension cable resistance which lowers the voltage applied to the transducer.

The rated output with lowered sensitivity is obtained from the following equation:

$$\text{Rated output : } \varepsilon_0 = \left(\frac{R}{R + (r \times L)} \right) \varepsilon_i$$

- R : Transducer's input resistance (Ω)
 r : Extension cable's reciprocating resistance (Ω/m)
 L : Extension cable length (m)
 ε_i : Rated output written in the Test data sheet

8. Storage and inspection

- 8.1 Avoid water, oil, dust, etc. on the connector.
 8.2 Recommend calibrate the product once a year or so. (Contact your KYOWA representative.)
 8.3 If suspicious outputs have occurred, check the input resistance, output resistance and insulation resistance. Provided that the connector operates properly and that the insulation resistance between the mainframe and conductors is below 100M Ω , the cause may be failure.
 In this case, contact your KYOWA representative.

Caution

- To measure insulation resistance, apply a voltage lower than 50V to the insulation resistance tester.

9. Specifications

Models.	Rated capacity.	Natural frequency. (Approx.)
PG-2KU	200kPa	2kHz
PG-5KU	500kPa	4kHz
PG-10KU	1MPa	7kHz
PG-20KU	2MPa	13kHz
PG-50KU	5MPa	21kHz
PG-100KU	10MPa	29kHz
PG-200KU	20MPa	40kHz
PG-300KU	30MPa	45kHz
PG-500KU	50MPa	50kHz

◆Performance

Rated Capacity	See table above.
Nonlinearity	Within $\pm 0.2\%$ RO (2,5,10KU: Within $\pm 0.3\%$ RO)
Hysteresis	Within $\pm 0.2\%$ RO (2,5,10KU: Within $\pm 0.3\%$ RO)
Repeatability	0.1%RO or less
Rated Output	2mV/V $\pm 0.5\%$ (2,5,10KU: $\pm 1\%$ RO or less)

◆Environmental Characteristics

Safe Temperature	-20 to 70°C
Compensated Temperature	-10 to 60°C
Temperature Effect on Zero	Within $\pm 0.02\%$ RO/°C
Temperature Effect on Output	Within $\pm 0.02\%$ /°C

◆Electrical Characteristics

Safe Excitation	15V AC or DC
Recommended Excitation	1 to 10V AC or DC
Input Resistance	350 $\Omega \pm 1\%$
Output Resistance	350 $\Omega \pm 1\%$
Accessory Cable (TT-01)	4-conductor (0.3mm ²) chloroprene shielded cable, 7.6mm diameter by 3m long, terminated with a connector plug Sensor side: 1108-12A10-7M Measuring instrument side: PRC03-12A10-7M (When connected the attached cable, shield wire is connected to the case.)

◆Mechanical Properties

Safe Overloads	150%
Natural Frequencies	See table above.
Material	Case: Anode oxidized coated aluminum Liquid-contacting part: SUS630 For 10KU or more, the case is die case zinc alloy.
Weight	Approx.300g (2,5KU: Approx.500g) (Excluding Cable)
Mounting Screw	G3/8, male
Compliance	Directive 2011/65/EU, (EU) 2015/863 (10 restricted substances) (RoHS)

[NOTE]

Products with CE Marking are compliant European RoHS Directive.

◆Accessories

Gasket (Mild copper)	3
Accessory Cable (TT-01)	1
Test Data Sheet	1
Instruction manual	1 (This book)

PG-U型 圧力変換器－取扱説明書

このたびは本製品をお買い上げいただきまして、ありがとうございます。ご使用前には、本書を必ずお読みください。また、お読みになったあとはいつでも見られるところに必ず保管してください。

本書に記載の仕様・外観は予告なく変更させていただく場合があります。最新情報は弊社ホームページをご確認ください。

1. 取扱説明書中のマークについて

ご使用になる方の安全確保に関する重要な事項や機能確保に関する事項にはマークをつけて記載していますので、必ずお読みください。

警告	取扱を誤った場合、人体に重大な悪影響を及ぼす恐れがあります。
注意	取扱を誤った場合、人体に悪影響を及ぼす恐れがあります。
注意	故障しないようにするための注意や正しく動作させるための注意を記載しています。

2. ご使用に際しての重要なご注意

本製品は、水素環境下ではご使用できません。

3. 安全上のご注意

警告
● 許容過負荷を超える圧力をかけないでください。破裂する恐れがあります。 ● 受感部に突起物をあてないでください。傷がつき破裂する恐れがあります。 ● 指定された締め付けトルクで使用してください。締め付けトルクが適正でないと破裂する恐れがあります。 ● 予測できない過大圧力が負荷される恐れがある場合は、周囲に保護ケースを設置し、安全を確保してください。 ● 取り付けねじ穴部の材質には十分な強度のあるものを選定してください。

注意
● 取り外しは圧力が完全に解放されていることを確認してから行ってください。 ● 接液部の材質はSUS630 (JIS G4303) を使用しています。本材質が腐食する恐れのある液体、気体には使用しないでください。 ● 200～500kPaは耐久試験、疲労試験でのご使用はできません。 ● 空気抜きニードルネジを装備しているため、ガス圧測定で長期間の微小範囲での出力の安定性を重視する計測での使用はお避け下さい。


4. 使用上のご注意

注意
● 変換器を分解しないでください。 ● 受圧面、ねじ部等に傷を付けないでください。 ● 保護等級はIP54です。水没させての使用は出来ません。 ● 変換器を結露させないでください。 結露した場合は速やかに乾燥させてください。 ● ケーブルを引き出し口付近で強引に曲げないでください。 ケーブル曲げ半径は、ケーブル外径の6倍以上としてください。 ● 振動環境下で使用する場合は、ケーブル引き出し口付近でケーブルを固定し、振動止めを施してください。 ● できるだけ圧力源に近い場所に変換器を取り付けてください。 ● 動的現象での立ち上がり時間が短い場合は、変換器と測定器を含めた応答性が問題になります。各々の応答性を確認の上ご使用ください。

5. 取り付け

- 5.1 付属のガスケットを使用し、本体のスパナかけ部を利用して取り付けます。他の部分にスパナを掛けると変換器を破損させる恐れがあります。ケーブルがねじれて断線しないよう、ケーブルも一緒に回してください。


- ・推奨締め付けトルク：30N・m
- ・最大締め付けトルク：60N・m

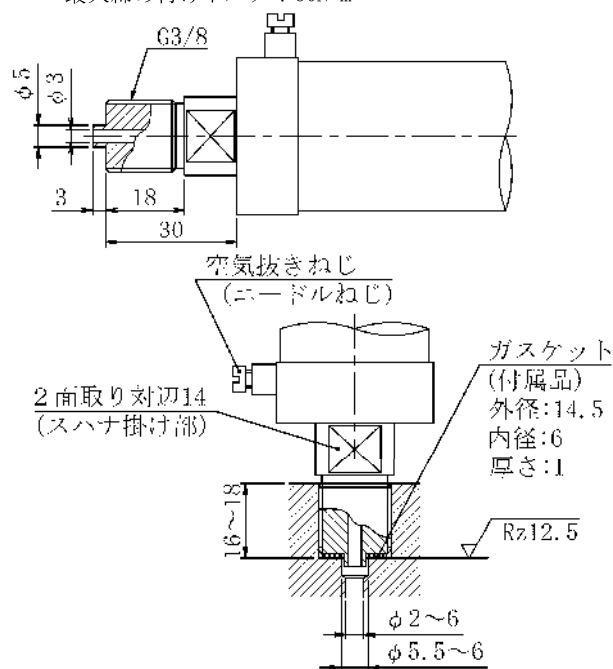

- 5.2 ガスケットは新しいものを使用してください。
- 5.3 シールテープをねじ部に巻き付けてねじ込んでもシールできます。
- 5.4 被測定流体が液体の場合は、空気抜きねじをゆるめて被測定流体を変換器圧力室内に入れ、空気を追い出してください。
・空気抜きねじの締め付けトルク：0.5N・m
- 5.5 導管がある場合は導管との接続部にコックかバルブを設けて取り外しが簡単に出来るようにすると便利です。

6. 接続・測定

- 6.1 変換器をひずみ測定器に接続します。
- 6.2 弊社以外のひずみ測定器を使用される場合は、コネクタプラグへの配線は下図のようになっていますので確認のうえ接続してください。

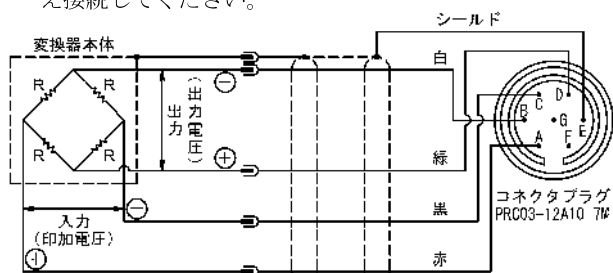

付属ケーブル接続時、シールドは本体に接続されています。

- 6.3 ヒートランを5分以上行ってから、測定を開始してください。

7. 換算

- 7.1 換算には検査成績書の校正係数を使用します。
- 7.2 ひずみ測定器を使用する場合は、出力値が ε ($\times 10^{-6}$ ひずみ) で表示されます。1 ($\times 10^{-6}$ ひずみ) に相当する圧力が検査成績書に記入されていますので、乗算により圧力が求められます。

圧力 (Pa) = ひずみ測定器の出力 ε ($\times 10^{-6}$ ひずみ)
 $\times$ 校正係数 (Pa/ 1×10^{-6} ひずみ)

- 7.3 その他の増幅器、記録器を使用する場合は、ブリッジ印加電圧を正確に計ることが必要になります。ブリッジ印加電圧1 (V) を加えたときの出力電圧1 (μ V) に相当する圧力が検査成績書に記入されていますので乗算により圧力が求められます。

圧力 (Pa) = $\frac{\text{ブリッジ出力電圧}(\mu\text{V})}{\text{ブリッジ印加電圧}(\text{V})} \times \text{校正係数}(\text{Pa}/1 \mu\text{V}/\text{V})$

変換器のケーブル延長による感度低下

ひずみゲージ式変換器とシグナルコンディショナ、変換器用デジタル表示器、ひずみ測定器などを接続して使用する測定で、ケーブルを延長する場合、延長するケーブルの持つ抵抗値により生ずる感度低下は無視できなくなります。これは、ケーブル抵抗値により変換器に加わる電圧（印加電圧）が低下するためです。

感度低下後の定格出力 (ε_0) は

$$\varepsilon_0 = \left(\frac{R}{R + (r \times L)} \right) \times \varepsilon_i$$

R : 変換器の入力抵抗値 (Ω)

r : 延長するケーブル1mあたりの往復の抵抗値 (Ω/m)

L : 延長するケーブル長さ (m)

ε_i : 検査成績書に記載されている定格出力より求められます。

8. 保管上の注意および点検

- 8.1 コネクタプラグには水、ゴミ、油などがつかないようにしてください。
- 8.2 年に1回程度の再校正をお勧めします。（弊社にお申し付けください）
- 8.3 初期値、指示値が異常と思われる場合は、入力抵抗、出力抵抗、回路（コネクタプラグのピンA～Dのいずれか）と本体間の絶縁抵抗（100M Ω 以上）を測定してください。異常があれば本器の故障と考えられます。弊社営業までご連絡ください。

注意

- 絶縁抵抗を測定する場合、絶縁抵抗計の印加電圧は50V以下で行ってください。

9. 仕様

型式名	定格容量	固有振動数
PG-2KU	200kPa	約 2kHz
PG-5KU	500kPa	約 4kHz
PG-10KU	1MPa	約 7kHz
PG-20KU	2MPa	約 13kHz
PG-50KU	5MPa	約 21kHz
PG-100KU	10MPa	約 29kHz
PG-200KU	20MPa	約 40kHz
PG-300KU	30MPa	約 45kHz
PG-500KU	50MPa	約 50kHz

◆性能

定格容量	上記表参照
非直線性	$\pm 0.2\%R_0$ 以内 (2～10KU: $\pm 0.3\%$ 以内)
ヒステリシス	$\pm 0.2\%R_0$ 以内 (2～10KU: $\pm 0.3\%$ 以内)
繰り返し性	0.1% R_0 以下
定格出力	2mV/V (4000×10^{-6} ひずみ) $\pm 0.5\%$ (2～10KU: $\pm 1\%$)

◆環境特性

許容温度範囲	-20～70℃
温度補償範囲	-10～60℃
零点の温度影響	$\pm 0.02\%R_0/^\circ\text{C}$ 以内
出力の温度影響	$\pm 0.02\%/^\circ\text{C}$ 以内

◆電気的特性

許容印加電圧	15V ACまたはDC
推奨印加電圧	1～10V ACまたはDC
入力抵抗	350 $\Omega \pm 1\%$
出力抵抗	350 $\Omega \pm 1\%$
付属ケーブル (TT-01)	0.3mm ² , 4心シールドクロロブレン3m, 外径7.6mm, 先端コネクタプラグ 変換器側: 1108-12A10-7M 測定器側: PRC03-12A10-7M (付属ケーブル接続時、シールドは本体に接続されています)

◆機械的特性

許容過負荷	150%
固有振動数	上記表参照
材質	本体アルミ (アルマイト処理) 接液部 SUS630 10KU以上の本体は亜鉛合金ダイキャスト
質量	約300g (2, 5KUは約500g) (ケーブル含まず)
保護等級	IP54 (JIS C0920)
取付ねじ	G3/8おねじ
適合指令	RoHS指令 2011/65/EU, (EU) 2015/863 (10物質) (注) RoHS指令対応品は、CEマークの表記付き製品に限ります。

◆付属品

ガスケット (軟銅)	3個
付属ケーブル (TT-01)	1本
検査成績書	1部
取扱説明書	1部 (本書)